


Screws $\Phi 5\text{mm}$ and spacers

SHAR SPLICE		35	63	65	80	85	100
Qty of screws per m		110	200		280		
Qty of spacers per meter		10					
PIZ bit needed		PZ 2					
Belt thickness	Spacers type	Screw size Φ × L mm					
4~5	5H5	5×10	5×10	5×12	5×12	NONE	NONE
5~7	5H5	5×12	5×12	5×14	5×14	5×16	5×16
7~9	5H7	5×14	5×14	5×16	5×16	5×18	5×18
9~11	5H9	5×16	5×16	5×18	5×18	5×20	5×20
11~13	5H11	5×18	5×18	5×20	5×20	5×22	5×22
13~15	5H13	N/A	N/A	N/A	5×22	5×24	5×24

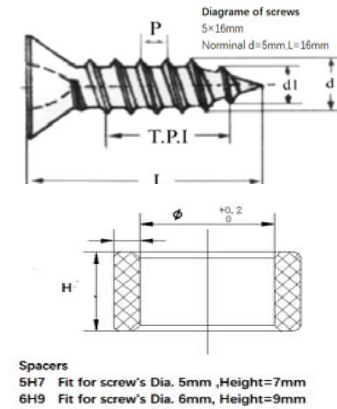

Screws $\Phi 6\text{mm}$ and spacers

SHAR SPLICE		125	127	180	185	200	205
Qty of screws per m		254					
Qty of spacers per meter		10					
PIZ bit needed		PZ 3					
Belt thickness mm	Spacers type	Screw size $\Phi \times L$ mm					
7~8	6H7	6×19.5	6×21	6×19.5	6×21	6×21	6×22.5
8~10	6H9	6×21	6×22.5	6×21	6×22.5	6×22.5	6×24
10~11.5	6H11	6×22.5	6×24	6×22.5	6×24	6×24	6×25.5
11.5~13	6H11	6×24	6×25.5	6×24	6×25.5	6×25.5	6×27
13~14.5	6H15	6×25.5	6×27	6×25.5	6×27	6×27	6×28.5
14.5~16	6H15	6×27	6×28.5	6×27	6×28.5	6×28.5	6×30
16~17.5	6H17	6×28.5	6×30	6×28.5	6×30	6×30	N/A

